

X-D1000 Technical Specification

Wuhan X-Dynamics Co., Ltd

March, 2023

Change Record

Version	Revision Date	Revised Chapter	Revision History
V1.1.1	2023/03/02	All chapters	First Edition
V1.1.2	2024/04/10	Chapter 2	Updated the specification
V1.1.3	2024/06/13	Chapter 3	Added the installation instruction

Copyright Notes

Copyright ©Wuhan X-Dynamics Co., Ltd. All rights reserved.

Declaration of Secrecy

Information from this document (all attachments included) is confidential.

The recipient understand that the document is confidential, should neither use it for any other purpose beyond that allowed nor disclose it to any third party.

Contents

1. Product Overview	4
2. Specification Parameter	4
2.1. Product pictures	4
2.2. Product Specification	5
3. Structure Description and Interfaces	7
3.1. Structural Drawing	7
3.2. Hardware interface definition	8
3.3. Accessories	9
3.4. Connection Schematic Diagram	9
3.5. Installation Instructions	10
3.6. Heat Dissipation Suggestion	11
4. Electrical Characteristics	11
4.1. Power Supply and Power Consumption	11
4.2. Reliability Standards	12
5. Version updating and relevant SDK	12
5.1. Version Updating	12
5.2. SDK Instructions	13
6. Appendix	13
6.1. System Integration Guidance	13
6.2. Use Suggestions	13
6.3. Attentions	14

X-D1000 Technical Specification

1. Product Overview

The X-D1000 is an industrial camera based on the 3DiToF (indirect Time-of-Flight) technology solution.

The sensor emits the modulated near-infrared light which is reflected after encountering the object, calculates the phase difference between emission and reflection before transmit it into a time difference to convert the distance of the shot scene, so as to forms depth information and finally present the object's three dimensional profile in topographic maps with different colors representing different distances. This product can be widely used in industrial measurement, application scenarios with requirements of 3D images in consumer electronics and other fields.

The technical solution provides high precision (millimeter lever) depth maps and 3D point cloud maps, X-D1000 camera integrated with RGB to output pixel-aligned RGBD images. It can also provides full platform SDK, which support Windows /Linux(PC or ARM)/ROS system fit applications from different industries.

Product X-D1000 Features:

- Large field of view, small blind area
- Long ranging distance, high precision
- Self-developed high-precision calibration and correction algorithm
- Ambient light/ multi-path/ multi-machine interference resistance algorithm.
- Post-processing algorithms: image denoising, flying spot elimination

2.Specification Parameter

2.1.Product pictures

The product pictures are shown as below:



Figure 1. Front view effect picture of X-D1000



Figure 2. Rear view effect picture of X-D1000

2.2.Product specification

Product specifications are as follows:

Table 1. Product specification sheet

Classification Name	Performance Indicators	Index Parameter	Note
System parameter System parameter	Site environment	Indoors, outdoors	
	Anti-glare interference degree	90k lux	
	Operating temperature	-20°C ~ 60°C	
	Safety class	Laser Class 1	
	Protection grade	IP67	
	Certification	CE、FCC	
	Size	84mm x 73mm x 35mm	
Electric parameter	Communication interface	Million Ethernet interface	
		CAN interface	Optional
		Hardware trigger interface	Optional
	Power interface	DC5521	
	Supply voltage	20~24V	
	Rated power consumption	DC24V / 12W	
TOF	Resolution	640 x 480 / 320 x 240	
	Frame rate	5fps@640 x 480 / 20fps@320 x 240	
	Ranging	0.2~10m@10% reflectivity 0.2~10m@90% reflectivity	
	Ranging accuracy	1%@whole range	
	FOV	105° x 75°	

	Wave length	940nm	
RGB	Resolution	1920 x 1080	Whether it is configured or not can be determined as needed.
	Frame rate	20fps	
	FOV	84° x 60°	
	Shutter mode	Rolling shutter	
SDK	Operating system	Windows / Linux / ROS	
	Algorithm SDK	Preprocessing: Correction algorithm, depth calculation algorithm, etc; Postprocessing: Filtering algorithm, point cloud conversion, etc	
	Settable parameters	Resolution, exposure time, algorithm level	

3. Structure description and interface

3.1. Structural drawings

The structure drawings of product X-D1000 are as follows:

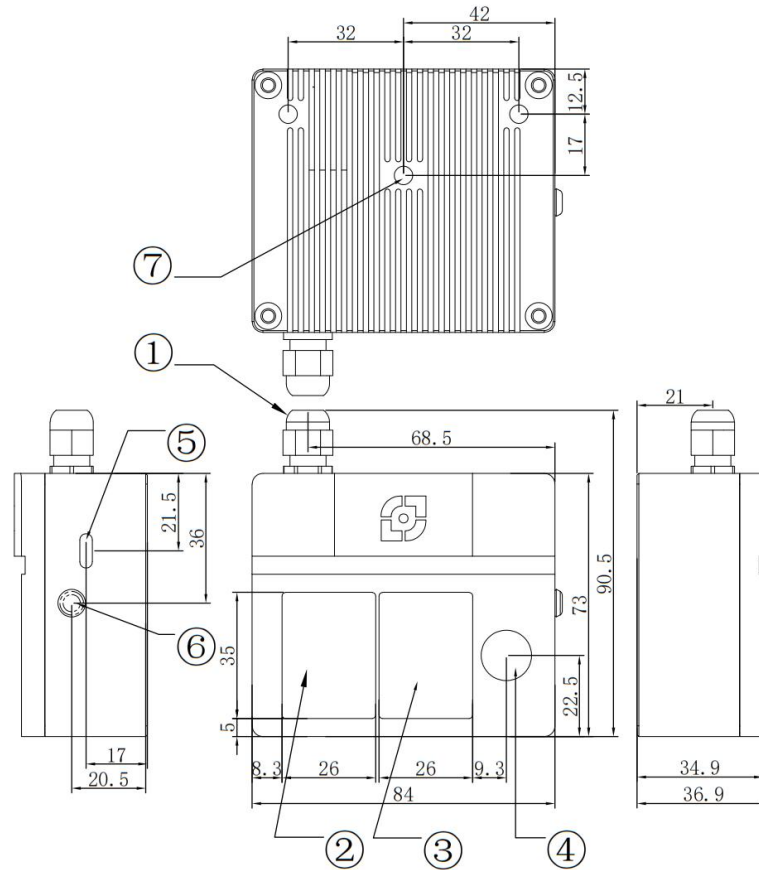


Figure 3. X-D1000 structure diagram

Unit :mm.

- ① Power supply and network communication outlet
- ② Protective glass over the Vcsel
- ③ Protective glass over the sensor
- ④ Protective glass over the RGB module
- ⑤ Type-C interface;
- ⑥ Status indicator lamp;
- ⑦ Mounting holes (4 in total) for depth 4mm M4 screws

3.2.Hardware interface definition

The hardware interface structure are shown as below :



Figure 4. X-D1000 product interface diagram

The corresponding interface specifications in the product interface diagram are shown in the following table:

Table 2. Interface specifications sheet

Interface	No.	Output
Hardware interface	①	Million Ethernet interfaces
	②	DC5521 power supply interface

3.3.Accessories

The camera accessories parameters are as follows:

Suggested adapter: 24V/5A;

Suggested adapter interface: DC5521 male terminal

3.4.Connection Schematic Diagram

The product connection schematic diagram is as follows:


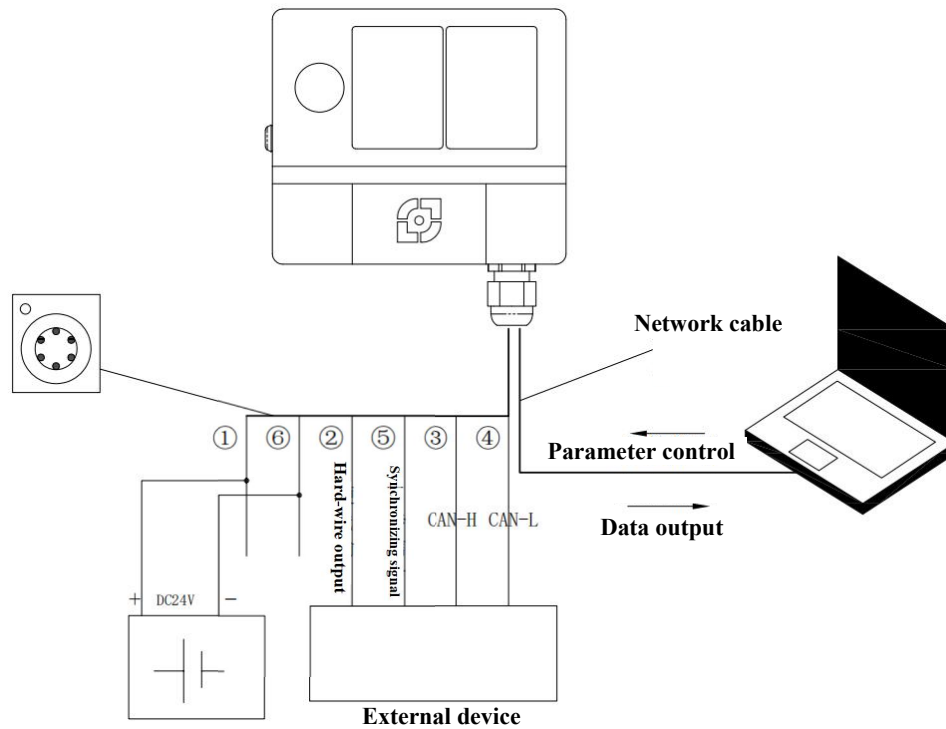


Figure 5. Product connection diagram

3.5.Installation Instructions

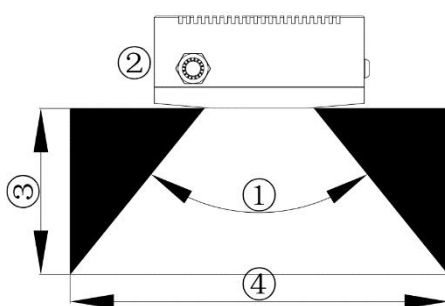

- ① FOV (angle of field of view)
- ② Camera
- ③ Distance between camera and object
- ④ Field of view

The installation instructions are as follows:

- (1) The target object must be completely within the field of view ④.
- (2) When installing or positioning, please consider the tolerances.
- (3) The distance between the camera and the target, named as ranging, has a maximum value need to be noticed during the actual use.
- (4) The smaller the value of ③, the higher the accuracy.

- (5) When selecting the installation position, the cleanliness of the external lens of the camera should be considered.
- (6) There should be no other transparent object between the camera and the measured object, because reflected lights or light go through the transparent object will cause measurement distortion.
- (7) Extra glass on the camera lens is not suggested because of light energy decrement caused by transmittance reduction.
- (8) The coverage area ④ of the product is directly related to the distance ③. Please refer to the FOV extension position of 3D or consult from technician personnel to get more parameters information.

3.6.Heat Dissipation Suggestion

The housing design can meet the heat dissipation needs of this product but if further reduction of the temperature rise to improve the product effect is required, the following solutions to improve the heat dissipation efficiency can be considered:

1. Install the product in cross ventilation area.
2. Placed some metal materials on the fixed position where directly contact with the product in order to assist heat dissipation.
3. Add a fan or radiating fin to assist heat dissipation.

Electrical Characteristics

4.1.Power Supply and power consumption

X-D1000 related parameters are shown as follows:

Table 3. Power supply parameters and specifications

Average power consumption	12W
Average current	0.5A
Peak current	5A

Rated voltage	24V
Nominal input voltage range	20~24V
Minimum input voltage	20V
Maximum input voltage	26.4V
Electrical connection between the main-board and product housing	Contact directly

4.2. Reliability Standards

The reliability standard parameters of X-D1000 are shown as below:

Table 4. Reliability standards

Operating temperature	-20°C~60°C
Storage temperature	-40°C~80°C
Protect grade	IP 67

Version Updating and Relevant SDK

5.1. Version Updating

- (1) Version upgrade/downgrade can be carried out through the upper computer independently developed by X-Dynamics. For detailed operations, please refer to the corresponding upper computer user manual;
- (2) When upgrade processed, the camera needs to be restarted to take effect the new version. The communication modes such as network ports need to be kept in a stable state during the upgrading, otherwise, it may cause upgrade failure. If the upgrade fails, please just restart the camera and repeat the upgrade steps after camera is recognized.

5.2.SDK Instructions

SDK for Windows, Linux and ROS platforms are available. Please contact the relevant sales person for the latest SDK.

Table 5. SDK brief description table

SDK	Providing a general SDK development kit, including basic API, Demo programs, help documents, and some tool software;
Supported platform	Support cross-platform development. Windows/Linux(PC or ARM)/ROS;

6. Appendix

6.1.System Integration Guidance

Before using X-D1000 iToF camera for development, please contact X-Dynamics staff to get technical specifications, user manuals, upper computer info. etc. Preliminary assessment, commissioning, verification and other steps can be processed to determine whether it meets the requirements of mass production.

Recommended process:

- Read the X-D1000 specifications.
- Purchase and obtain X-D1000 samples through official channels.
- Before development, please contact X-Dynamics staff to obtain the user manuals and other materials.
- Choose the appropriate development platform according to the need.
- During the product development based on functions, if with any questions, please timely contact with X-Dynamics staff.
- Determine the mass production proposal of the final product.
- Mass production of the final product according to the mass production plan.

6.2.Use Suggestions

- (1) Remove the protective film in front of the lens before using the 3D camera;
- (2) Camera(especially for the position of the lens) should be as far away from heat sources as possible during the installation or using;
- (3) When using the 3D camera, please avoid the lens of the product being scratched by sharp objects;

- (4) Avoid frequent use of alcohol (organic solvent) to wipe the lens surface which take risk of damage to the coating. It is recommended to wipe with a pure lint-free cloth;
- (5) In scenes such as strong high-frequency vibration or external impact, please add appropriate protection conditions for the camera;
- (6) In severe environments such as over humid or strong dust condition, please add appropriate protection conditions for the camera;
- (7) Please refer to the 3D camera installation guide during the installation, and do not install the camera in any way may cause serious deformation to the camera.

6.3.Attentions

- (1) Self-purchased cables or cutting& re-connecting cables from the original ones need strict accordance with the cable definition in the specification, otherwise wrong cable may burn the camera, or cause abnormal signal.
- (2) During the using or testing, please never start power-on work when the 3D camera is installed backwards to table etc. or there is any non-transparent materials covering on the laser emitting surface. It can help avoid components damaged from overheated laser.
- (3) Although the 3D camera has passed the certification according to EN60825-1 CLASS 1, it is still recommended to avoid any human eyes looking directly at the lens of working device in close distance.
- (4) If the image frame rate is insufficient or the flow cannot be turned on during the using, it is recommended to reconnect the camera correctly after good contacts confirmed.
- (5) Disassembling the camera is prohibited.